

222 Cavalcade Street, 77009-3213
P.O. Box 8768, Houston, Texas 77249-8768
Tel: (713) 692-9151 Fax: (713) 696-6205

Attention: Robert Caves
American Plank
11102 Old Baton Rouge Hwy
Hammond, LA 70403
P: 225-567-5844 / F:

W/O. No.: AME512-08-19-59085-1
P.O. No.: Ck 1711
Report Date: 8/21/2009

Description: Walkboard Planks
Material: Perforated Steel

Point Load


Plank Size (in x in)	Max Load (lbs)	4:1 Safety Factor (lbs)
120 x 9	1,100	275
108 x 9	1,475	370
96 x 9	1,525	380
84 x 9	1,850	465
72 x 9	2,275	570
60 x 9	2,790	700
48 x 9	3,415	855
42 x 9	3,900	975
36 x 9	4,435	1,110
24 x 9	5,715	1,430

Uniform Load

Plank Size (in x in)	Max Load (lbs)	4:1 Safety Factor (lbs)
120 x 9	1,535	385
108 x 9	2,330	585
96 x 9	2,330	585
84 x 9	3,030	760
72 x 9	3,685	920
60 x 9	4,545	1,135
48 x 9	6,315	1,580
42 x 9	6,715	1,680
36 x 9	7,060	1,765
24 x 9	7,970	1,995

Our letters and reports are for the exclusive use of the client to whom they are addressed and shall not be reproduced except in full without the approval of the testing laboratory. The use of our name must receive our written approval. Our letters and reports apply only to the sample tested and/or inspected, and are not indicative of the quantities of apparently identical or similar products. Material submitted to our metals department will be discarded after a period of 30 days unless otherwise directed.

Respectfully Submitted


Terry Wilt
Manager, Product Evaluation

Stork SWL, is an operating unit of Stork Materials Technology B.V., Amsterdam, The Netherlands, which is a member of the Stork group

222 Cavalcade Street, 77009-3213
P.O. Box 8768, Houston, Texas 77249-8768
Tel: (713) 692-9151 Fax: (713) 696-6205

Attention: Robert Caves
American Plank
11102 Old Baton Rouge Hwy
Hammond, LA 70403
P: 225-567-5844 / F:

W/O. No.: AME512-08-19-59085-1
P.O. No.: Ck 1711
Report Date: 8/21/2009

Identification: 120" x 9"
Description: Walkboard Planks
Material: Perforated Steel



Point load setup



Point load failure at 1,100 lbs



UDL setup

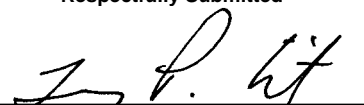


UDL failure at 1,535 lbs

Our letters and reports are for the exclusive use of the client to whom they are addressed and shall not be reproduced except in full without the approval of the testing laboratory. The use of our name must receive our written approval. Our letters and reports apply only to the sample tested and/or inspected, and are not indicative of the quantities of apparently identical or similar products. Material submitted to our metals department will be discarded after a period of 30 days unless otherwise directed.

Stork SWL, is an operating unit of Stork Materials Technology B.V., Amsterdam, The Netherlands, which is a member of the Stork group

Respectfully Submitted


Terry Wilt
Manager, Product Evaluation

222 Cavalcade Street, 77009-3213
P.O. Box 8768, Houston, Texas 77249-8768
Tel: (713) 692-9151 Fax: (713) 696-6205

Attention: Robert Caves
American Plank
11102 Old Baton Rouge Hwy
Hammond, LA 70403
P: 225-567-5844 / F:

W/O. No.: AME512-08-19-59085-1
P.O. No.: Ck 1711
Report Date: 8/21/2009

Identification: 108" x 9"
Description: Walkboard Planks
Material: Perforated Steel



Point load setup



Point load failure at 1,475 lbs.



UDL setup




UDL failure at 2,330 lbs.

Our letters and reports are for the exclusive use of the client to whom they are addressed and shall not be reproduced except in full without the approval of the testing laboratory. The use of our name must receive our written approval. Our letters and reports apply only to the sample tested and/or inspected, and are not indicative of the quantities of apparently identical or similar products. Material submitted to our metals department will be discarded after a period of 30 days unless otherwise directed.

Stork SWL, is an operating unit of Stork Materials Technology B.V., Amsterdam, The Netherlands, which is a member of the Stork group

Respectfully Submitted


Terry Wilt
Manager, Product Evaluation

222 Cavalcade Street, 77009-3213
P.O. Box 8768, Houston, Texas 77249-8768
Tel: (713) 692-9151 Fax: (713) 696-6205

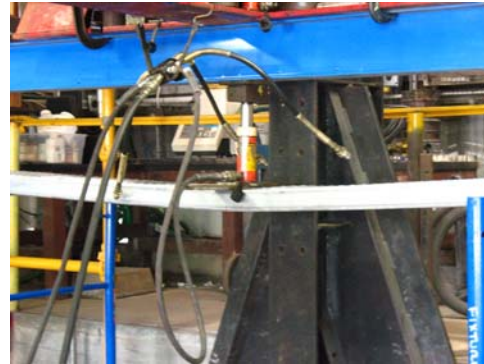
Attention: Robert Caves
American Plank
11102 Old Baton Rouge Hwy
Hammond, LA 70403
P: 225-567-5844 / F:

W/O. No.: AME512-08-19-59085-1
P.O. No.: Ck 1711
Report Date: 8/21/2009

Identification: 96" x 9"
Description: Walkboard Planks
Material: Perforated Steel



Point load setup



Point load failure at 1,525 bs.



UDL setup

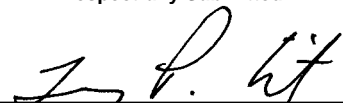


UDL failure at 2,330 lbs.

Our letters and reports are for the exclusive use of the client to whom they are addressed and shall not be reproduced except in full without the approval of the testing laboratory. The use of our name must receive our written approval. Our letters and reports apply only to the sample tested and/or inspected, and are not indicative of the quantities of apparently identical or similar products. Material submitted to our metals department will be discarded after a period of 30 days unless otherwise directed.

Stork SWL, is an operating unit of Stork Materials Technology B.V., Amsterdam, The Netherlands, which is a member of the Stork group

Respectfully Submitted


Terry Wilt
Manager, Product Evaluation

222 Cavalcade Street, 77009-3213
P.O. Box 8768, Houston, Texas 77249-8768
Tel: (713) 692-9151 Fax: (713) 696-6205

Attention: Robert Caves
American Plank
11102 Old Baton Rouge Hwy
Hammond, LA 70403
P: 225-567-5844 / F:

W/O. No.: AME512-08-19-59085-1
P.O. No.: Ck 1711
Report Date: 8/21/2009

Identification: 84" x 9"
Description: Walkboard Planks
Material: Perforated Steel



Point load setup



Point load failure at 1,850 lbs.



UDL setup

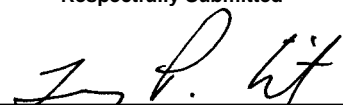


UDL failure at 3,030 lbs.

Our letters and reports are for the exclusive use of the client to whom they are addressed and shall not be reproduced except in full without the approval of the testing laboratory. The use of our name must receive our written approval. Our letters and reports apply only to the sample tested and/or inspected, and are not indicative of the quantities of apparently identical or similar products. Material submitted to our metals department will be discarded after a period of 30 days unless otherwise directed.

Stork SWL, is an operating unit of Stork Materials Technology B.V., Amsterdam, The Netherlands, which is a member of the Stork group

Respectfully Submitted

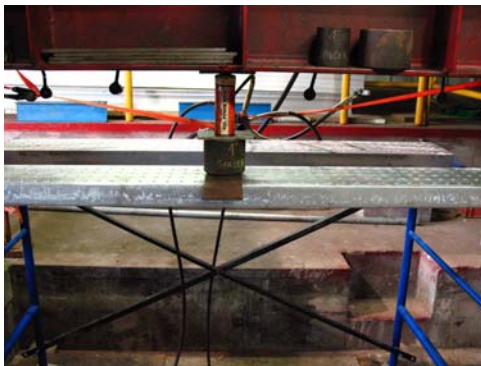

Terry Wilt
Manager, Product Evaluation

222 Cavalcade Street, 77009-3213
P.O. Box 8768, Houston, Texas 77249-8768
Tel: (713) 692-9151 Fax: (713) 696-6205

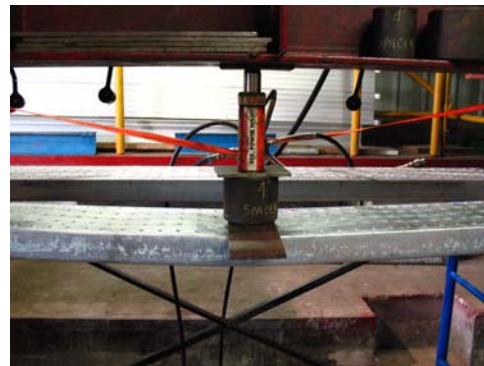
Attention: Robert Caves
American Plank
11102 Old Baton Rouge Hwy
Hammond, LA 70403
P: 225-567-5844 / F:

W/O. No.: AME512-08-19-59085-1
P.O. No.: Ck 1711
Report Date: 8/21/2009

Identification: 72" x 9"
Description: Walkboard Planks
Material: Perforated Steel



Point load setup



Point load failure at 2,275 lbs.



UDL setup




UDL failure at 3,685 lbs.

Our letters and reports are for the exclusive use of the client to whom they are addressed and shall not be reproduced except in full without the approval of the testing laboratory. The use of our name must receive our written approval. Our letters and reports apply only to the sample tested and/or inspected, and are not indicative of the quantities of apparently identical or similar products. Material submitted to our metals department will be discarded after a period of 30 days unless otherwise directed.

Stork SWL, is an operating unit of Stork Materials Technology B.V., Amsterdam, The Netherlands, which is a member of the Stork group

Respectfully Submitted


Terry Wilt
Manager, Product Evaluation

222 Cavalcade Street, 77009-3213
P.O. Box 8768, Houston, Texas 77249-8768
Tel: (713) 692-9151 Fax: (713) 696-6205

Attention: Robert Caves
American Plank
11102 Old Baton Rouge Hwy
Hammond, LA 70403
P: 225-567-5844 / F:

W/O. No.: AME512-08-19-59085-1
P.O. No.: Ck 1711
Report Date: 8/21/2009

Identification: 60" x 9"
Description: Walkboard Planks
Material: Perforated Steel



Point load setup



Point load failure at 2,790 lbs.



UDL setup

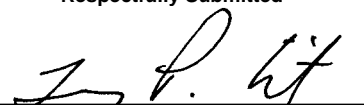


UDL failure at 4,545 lbs.

Our letters and reports are for the exclusive use of the client to whom they are addressed and shall not be reproduced except in full without the approval of the testing laboratory. The use of our name must receive our written approval. Our letters and reports apply only to the sample tested and/or inspected, and are not indicative of the quantities of apparently identical or similar products. Material submitted to our metals department will be discarded after a period of 30 days unless otherwise directed.

Stork SWL, is an operating unit of Stork Materials Technology B.V., Amsterdam, The Netherlands, which is a member of the Stork group

Respectfully Submitted


Terry Wilt
Manager, Product Evaluation

222 Cavalcade Street, 77009-3213
P.O. Box 8768, Houston, Texas 77249-8768
Tel: (713) 692-9151 Fax: (713) 696-6205

Attention: Robert Caves
American Plank
11102 Old Baton Rouge Hwy
Hammond, LA 70403
P: 225-567-5844 / F:

W/O. No.: AME512-08-19-59085-1
P.O. No.: Ck 1711
Report Date: 8/21/2009

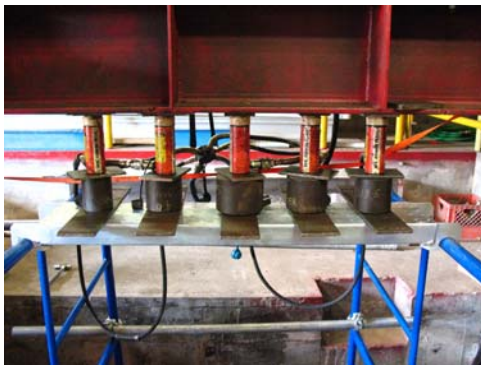
Identification: 48" x 9"
Description: Walkboard Planks
Material: Perforated Steel



Point load setup



Point load failure at 3,415 lbs.



UDL setup




UDL failure at 6,315 lbs.

Our letters and reports are for the exclusive use of the client to whom they are addressed and shall not be reproduced except in full without the approval of the testing laboratory. The use of our name must receive our written approval. Our letters and reports apply only to the sample tested and/or inspected, and are not indicative of the quantities of apparently identical or similar products. Material submitted to our metals department will be discarded after a period of 30 days unless otherwise directed.

Stork SWL, is an operating unit of Stork Materials Technology B.V., Amsterdam, The Netherlands, which is a member of the Stork group

Respectfully Submitted

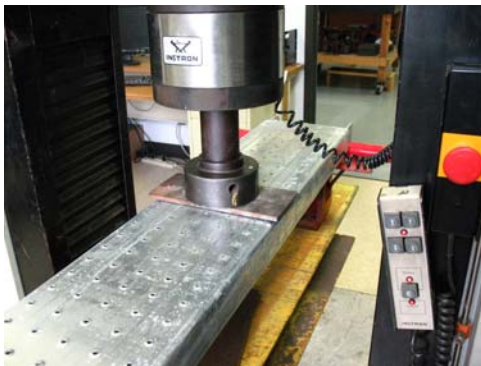

Terry Wilt
Manager, Product Evaluation

222 Cavalcade Street, 77009-3213
P.O. Box 8768, Houston, Texas 77249-8768
Tel: (713) 692-9151 Fax: (713) 696-6205

Attention: Robert Caves
American Plank
11102 Old Baton Rouge Hwy
Hammond, LA 70403
P: 225-567-5844 / F:

W/O. No.: AME512-08-19-59085-1
P.O. No.: Ck 1711
Report Date: 8/21/2009

Identification: 42" x 9"
Description: Walkboard Planks
Material: Perforated Steel



Point load setup



Point load failure at 3,900 lbs.



UDL setup

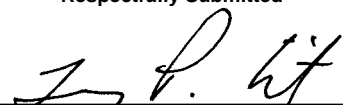


UDL failure at 6,715 lbs.

Our letters and reports are for the exclusive use of the client to whom they are addressed and shall not be reproduced except in full without the approval of the testing laboratory. The use of our name must receive our written approval. Our letters and reports apply only to the sample tested and/or inspected, and are not indicative of the quantities of apparently identical or similar products. Material submitted to our metals department will be discarded after a period of 30 days unless otherwise directed.

Stork SWL, is an operating unit of Stork Materials Technology B.V., Amsterdam, The Netherlands, which is a member of the Stork group

Respectfully Submitted


Terry Wilt
Manager, Product Evaluation

222 Cavalcade Street, 77009-3213
P.O. Box 8768, Houston, Texas 77249-8768
Tel: (713) 692-9151 Fax: (713) 696-6205

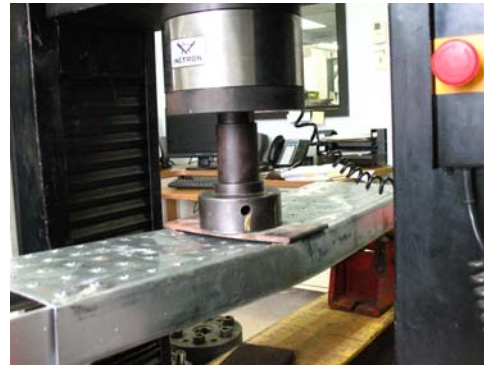
Attention: Robert Caves
American Plank
11102 Old Baton Rouge Hwy
Hammond, LA 70403
P: 225-567-5844 / F:

W/O. No.: AME512-08-19-59085-1
P.O. No.: Ck 1711
Report Date: 8/21/2009

Identification: 36" x 9"
Description: Walkboard Planks
Material: Perforated Steel



Point load setup



Point load failure at 4,435 lbs.



UDL setup

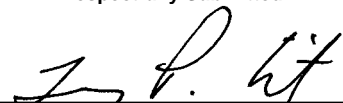


UDL failure at 7,060 lbs.

Our letters and reports are for the exclusive use of the client to whom they are addressed and shall not be reproduced except in full without the approval of the testing laboratory. The use of our name must receive our written approval. Our letters and reports apply only to the sample tested and/or inspected, and are not indicative of the quantities of apparently identical or similar products. Material submitted to our metals department will be discarded after a period of 30 days unless otherwise directed.

Stork SWL, is an operating unit of Stork Materials Technology B.V., Amsterdam, The Netherlands, which is a member of the Stork group

Respectfully Submitted


Terry Wilt
Manager, Product Evaluation

222 Cavalcade Street, 77009-3213
P.O. Box 8768, Houston, Texas 77249-8768
Tel: (713) 692-9151 Fax: (713) 696-6205

Attention: Robert Caves
American Plank
11102 Old Baton Rouge Hwy
Hammond, LA 70403
P: 225-567-5844 / F:

W/O. No.: AME512-08-19-59085-1
P.O. No.: Ck 1711
Report Date: 8/21/2009

Identification: 24" x 9"
Description: Walkboard Planks
Material: Perforated Steel



Point load setup



Point load failure at 5,715 lbs.



UDL setup




UDL failure at 7,970 lbs.

Our letters and reports are for the exclusive use of the client to whom they are addressed and shall not be reproduced except in full without the approval of the testing laboratory. The use of our name must receive our written approval. Our letters and reports apply only to the sample tested and/or inspected, and are not indicative of the quantities of apparently identical or similar products. Material submitted to our metals department will be discarded after a period of 30 days unless otherwise directed.

Stork SWL, is an operating unit of Stork Materials Technology B.V., Amsterdam, The Netherlands, which is a member of the Stork group

Respectfully Submitted


Terry Wilt
Manager, Product Evaluation